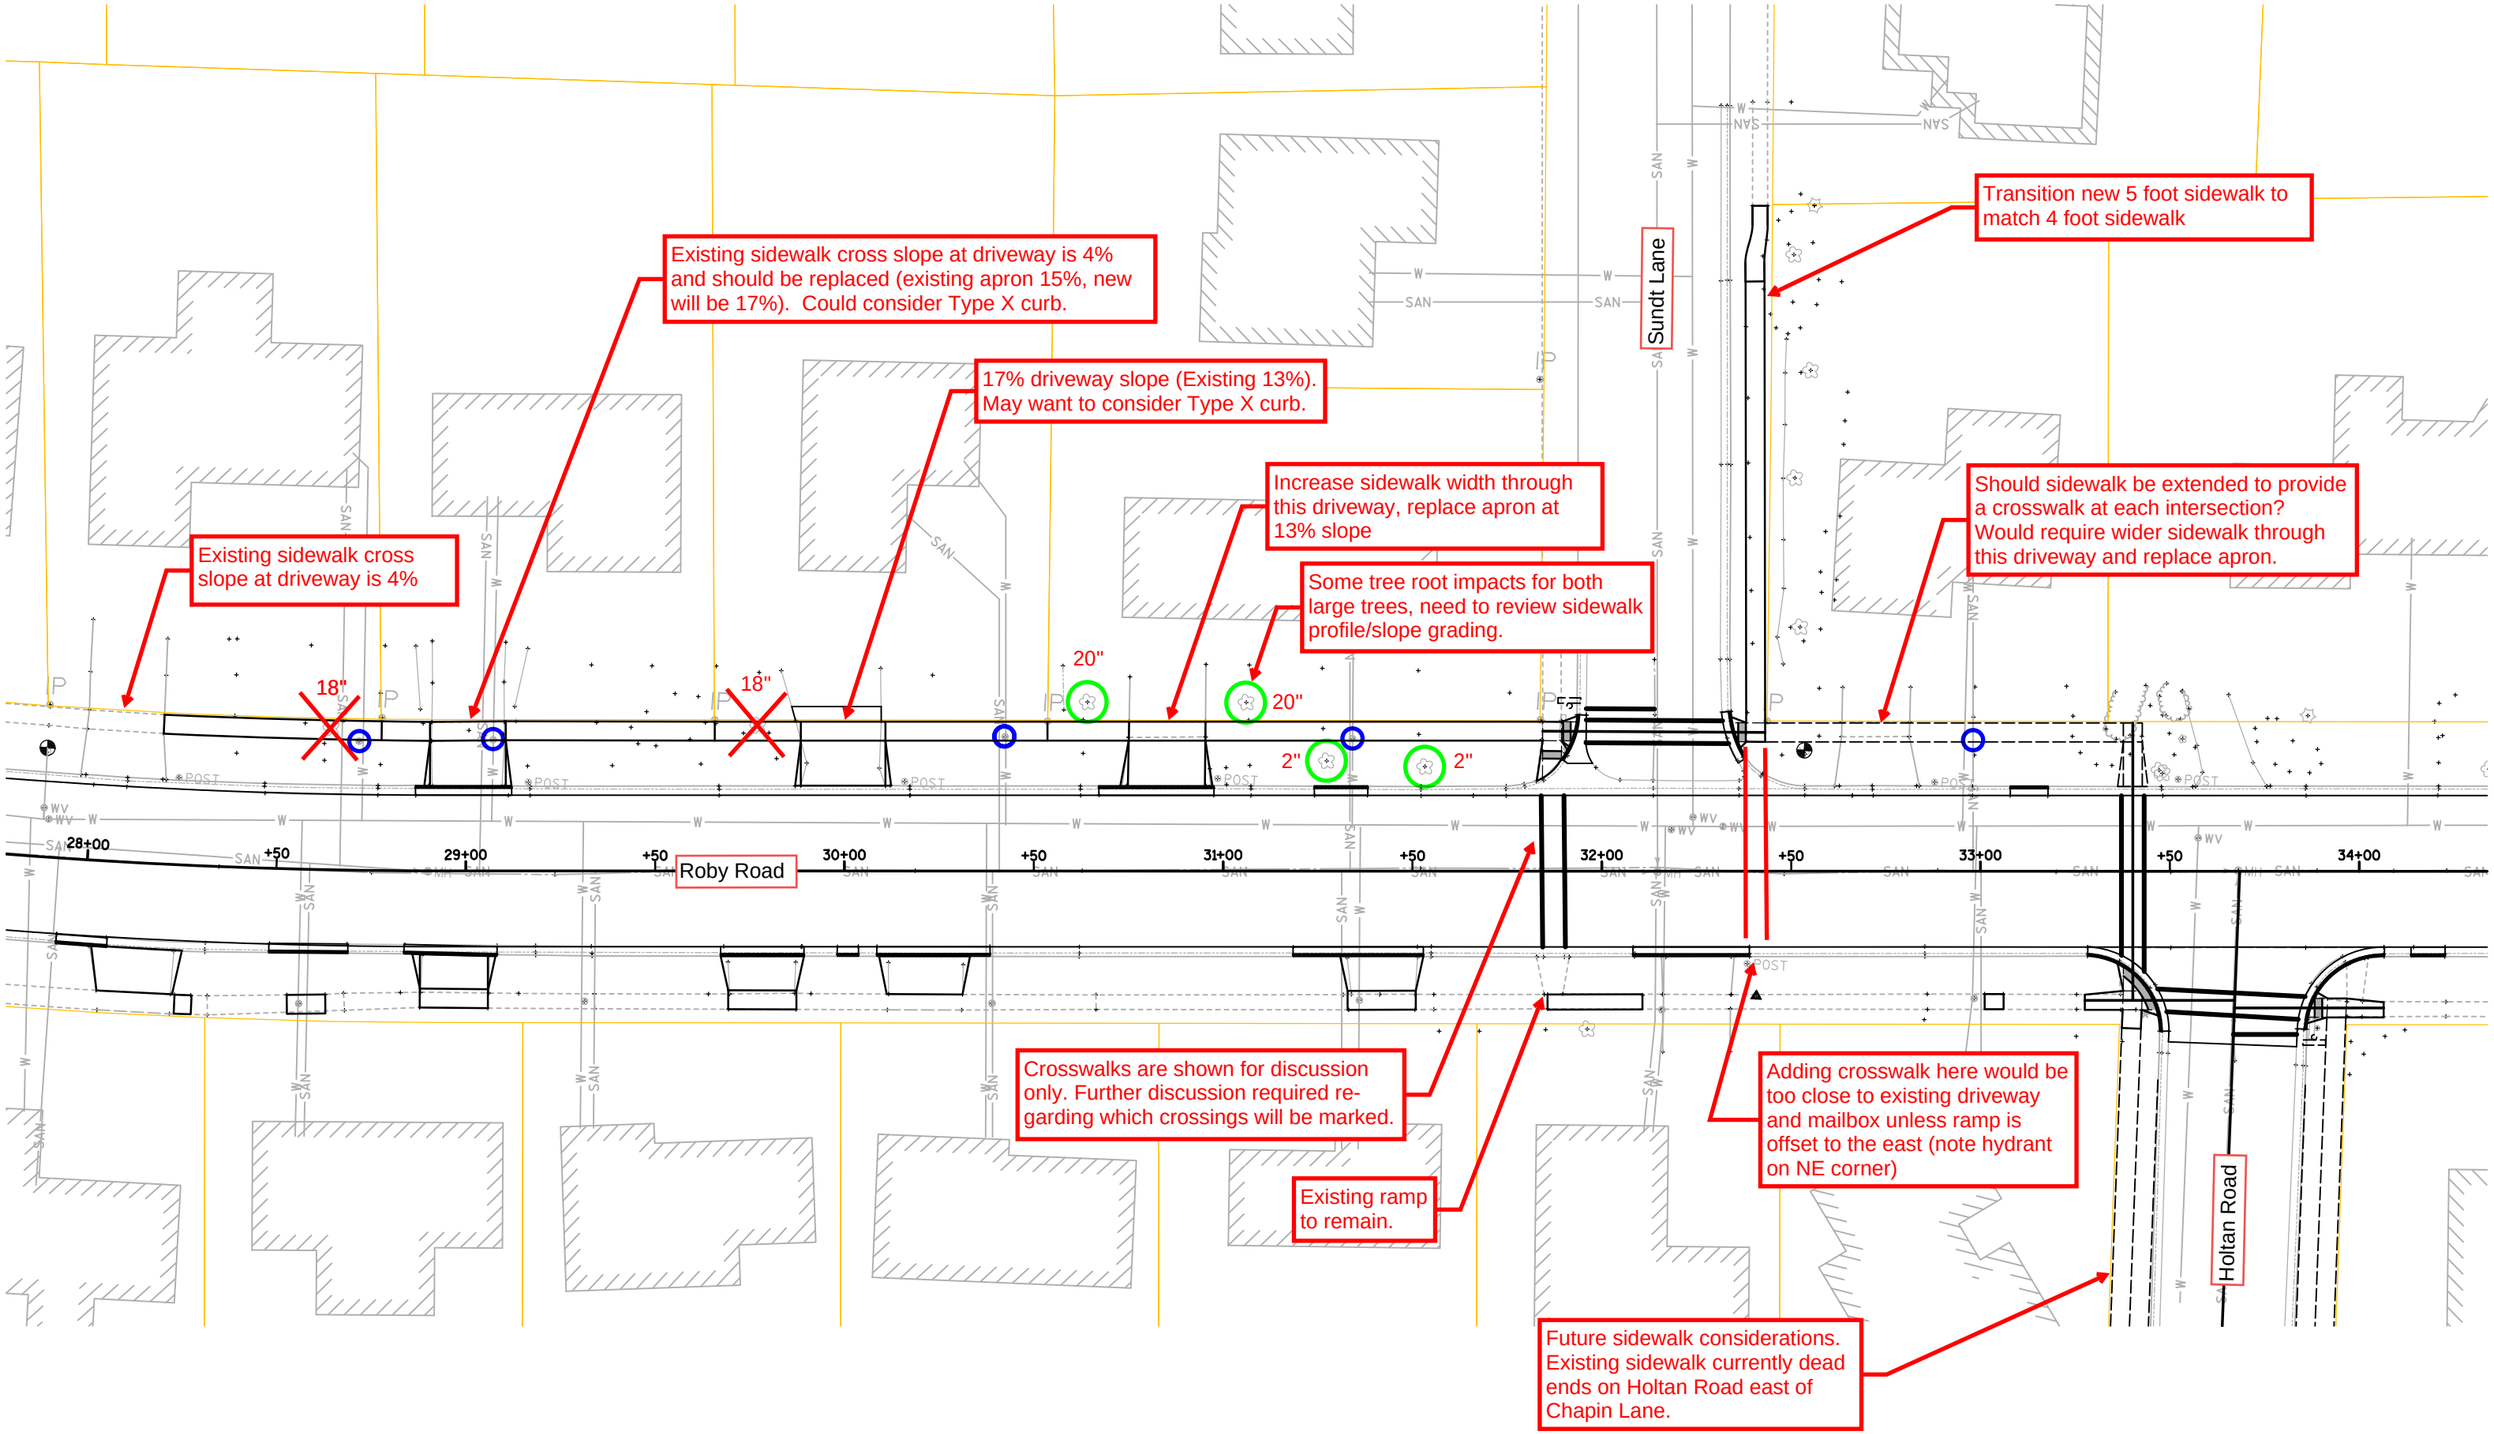
Existing sidewalk cross slope at driveway is 4% and should be replaced (existing apron 15%, new will be 17%). Could consider Type X curb.
17% driveway slope (Existing 13%). May want to consider Type X curb.
Transition new 5 foot sidewalk to match 4 foot sidewalk
Increase sidewalk width through this driveway, replace apron at 13% slope
Should sidewalk be extended to provide a crosswalk at each intersection? Would require wider sidewalk through this driveway and replace apron.
Existing sidewalk cross slope at driveway is 4%
Some tree root impacts for both large trees, need to review sidewalk profile/slope grading.
Sundt Lane
18"
18"
20"
20"
2"
2"
28+00
29+00
30+00
31+00
32+00
33+00
34+00
Roby Road
Crosswalks are shown for discussion only. Further discussion required regarding which crossings will be marked.
Adding crosswalk here would be too close to existing driveway and mailbox unless ramp is offset to the east (note hydrant on NE corner)
Existing ramp to remain.
Holtan Road
Future sidewalk considerations. Existing sidewalk currently dead ends on Holtan Road east of Chapin Lane.